


Part#	HT-X30284	Application	For 2016-2023 Mazda CX-9 All					
Hardware List	Item	Part Name	QTY	Description	Item	Part Name	QTY	Description
Hitch Parts	A	Hitch Body	1		B/C	Mounting Brackets	2	B-Driver Side C-Passenger Side
HW B (For Hitch Installation)	1#	Carriage Bolts	4	M12X1.75-35	3#	Spacers	4	With Square Hole
	2#	Hex Flange Nuts	4	M12	4#	Fishwires	2	
HW A (For Hitch Assembly)	5#	Hex Bolts	8	M12X1.75-35	7#	Hex Flange Nuts	8	M12
	6#	Flat Washers	16	M12				

Gross Load Capacity When Used As A Weight Carrying Hitch: 4000 LBS. Trailer Weight & 600 LBS. Tongue Weight.

Gross Load Capacity When Used As A Weight Distribution Hitch: 5000 LBS. Trailer Weight & 600 LBS. Tongue Weight

***DO NOT EXCEED VEHICLE MANUFACTURER'S RECOMMENDED TOWING CAPACITY. ***

* No Drilling Required

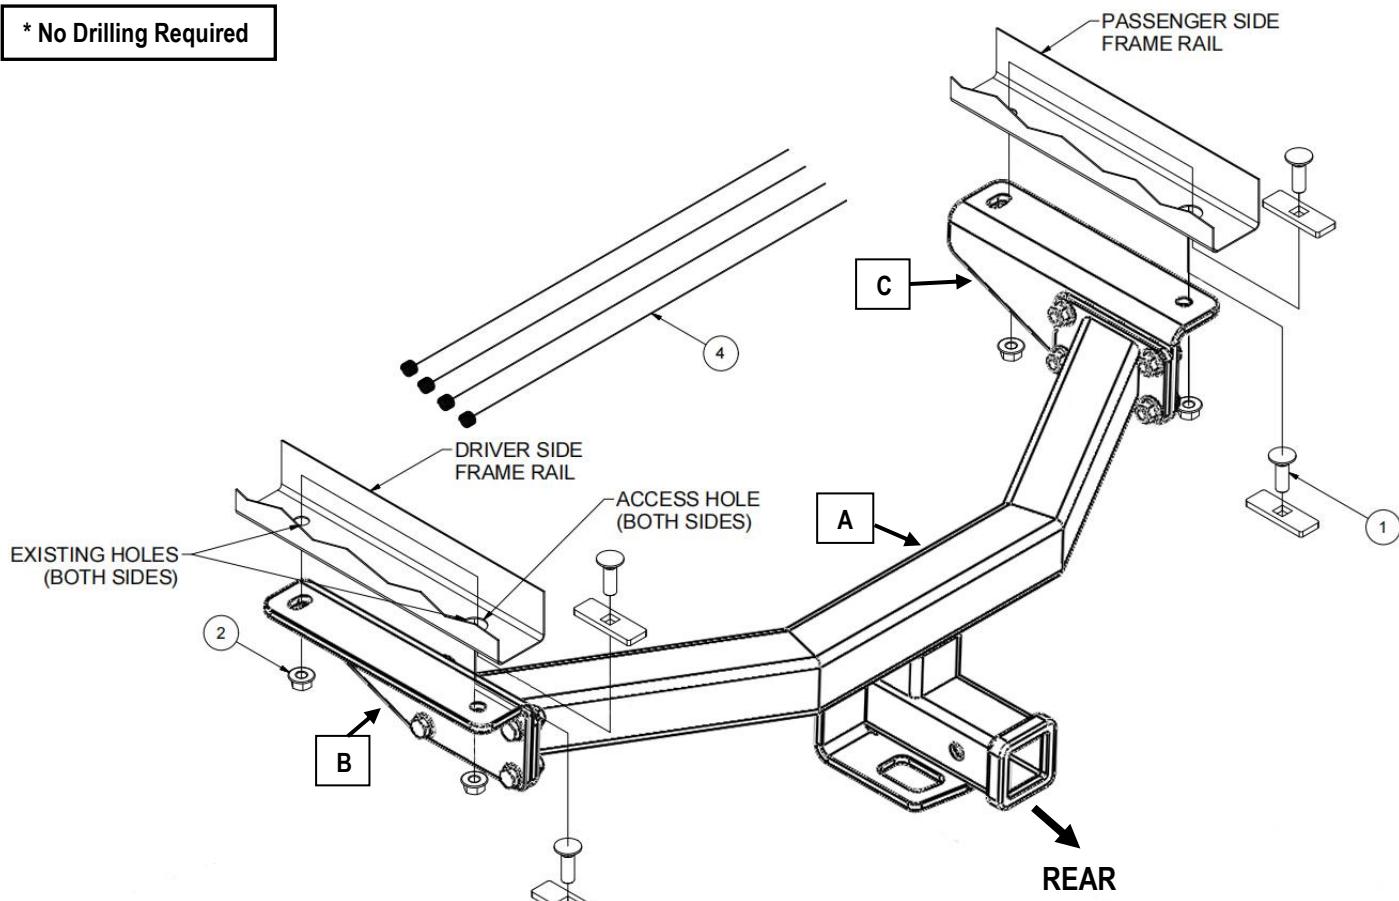


RUBBER ISOLATOR REMOVAL DIAGRAM

This technique can be used if exhaust hanger removal pliers are not available.

Using a 5/8" open end wrench, slide the wrench up to the rubber isolator, cradling the hanger rod as shown.

Place the flat edge of a pry bar between the wrench and the hanger stop or hanger rod. Then simply rotate the pry bar toward the wrench to remove the rubber isolator.


Note: Using a lubricant or soapy water on the hanger rod and the rubber isolator helps removal.

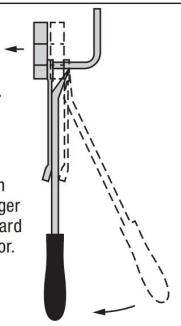

FISHWIRE TECHNIQUE


INSERT COILED END OF FISHWIRE TOOL THROUGH HITCH MOUNTING HOLE IN VEHICLE FRAME RAIL AND OUT THE ACCESS HOLE. PASS COILED END OF FISHWIRE THROUGH SPACER AND THREAD BOLT INTO COIL. KINK WIRE TO KEEP SPACER SEPERATE FROM BOLT AS SHOWN. PULL FISHWIRE, SPACER, AND BOLT THROUGH FRAME AND OUT MOUNTING HOLE. USE FISHWIRE TO GUIDE HITCH DURING MOUNTING AND PREVENT LOSS OF BOLT / SPACER INSIDE FRAME RAIL.

NOTE: SOME VEHICLES MAY FISHWIRE THROUGH END OF FRAME

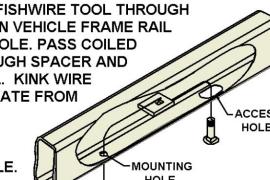

REVERSE PULL FISHWIRE TECHNIQUE

ATTACH FISHWIRE TO CARRIAGE BOLT AND SLIDE SPACER ONTO FISHWIRE. PUSH THE BOLT THRU THE HOLE FOLLOWED BY THE SPACER (AS SHOWN). PULL BOLT BACK INTO POSITION, PROTRUDING FROM THE FRAME.

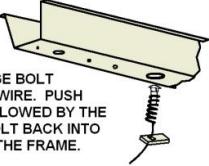

The instruction here is for your reference only. We strongly recommend the professional installer for best result.
We are not responsible for any damage caused by the installation. Thank you for choosing our product!



Hitch Installation Instruction

Part#	HT-X30284	Application	For 2016-2023 Mazda CX-9 All
Step	Description		
1	Assemble Hitch Body (A) and Mounting Brackets (B, C) with (8) M12X1.75-35mm Hex Bolts, (16) M12 Flat Washers, (8) M12 Hex Flange Nuts.(Hardware in "HW A"). Note: Finger tighten only. Do not fully tighten at this time.		
2	Remove lower trim panel from vehicle by removing two (2) plastic fasteners using a flat-head screw driver and two (2) hex nuts with a 10mm socket. Return trim panel to owner.		
3	Remove four (4) rubber exhaust hangers using exhaust removal pliers or method shown above. Make sure exhaust is supported.		
4	Fishwire one (1) M12 carriage bolt and one (1) Spacer through access hole and into forward-most hole in each frame rail. Leave fishwires attached.		
5	Reverse fishwire one (1) M12 carriage bolt and one (1) Spacer through access hole in each frame rail. Leave fishwires attached.		

The instruction here is for your reference only. We strongly recommend the professional installer for best result.
We are not responsible for any damage caused by the installation. Thank you for choosing our product!



Hitch Installation Instruction

Part#	HT-X30284	Application	For 2016-2023 Mazda CX-9 All
6	Raise hitch into position guiding fishwire ends through attachment holes. Remove fishwires and secure hitch with M12 hex flange nuts.		
7	 Torque all M12 Carriage Bolts to 58 ft-lbs, M12 Hex Bolts to 86 lbs, M10 Hex Bolts to 47 lbs. Raise exhaust back into position and re-install exhaust hangers. Installation Complete.		

*****Periodically Check The Receiver Hitch To Ensure That All Fasteners ***
Are Tight & All Structural Components Are Sound.**

The instruction here is for your reference only. We strongly recommend the professional installer for best result.
We are not responsible for any damage caused by the installation. Thank you for choosing our product!