

iBoard[®]

iBoard[®] by APS

PART#: IB-212A-B

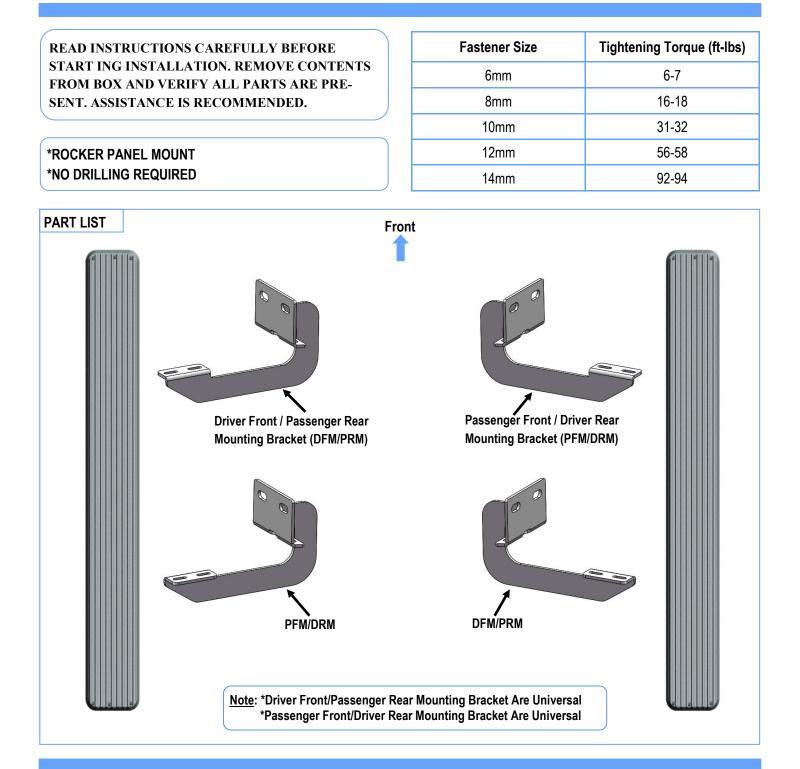


iBoard®

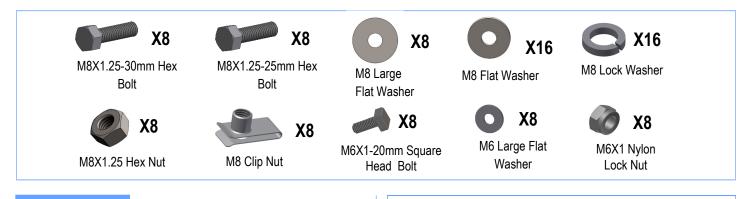

STEP 1


Starting on the driver side of the vehicle, locate the (2) holes in the bottom of the body panel, (pinch weld), toward the front tire, (Fig 1). Next locate the rectangular opening and (2) small holes in the inner body panel directly above the holes in the pinch weld, (Figs 1 & 2). NOTE: The holes in the inner panel may be covered with sealing tape or insulation.

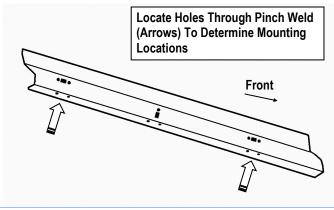

(Fig 1) Driver Inner Body Panel Illustrated

STEP 2

Slide (1) M8 Clip Nut into the rectangular opening with the nut towards the inside. Line up the threaded nut on the clip with the round hole, (**Fig 2**). Repeat to install the 2nd M8 Clip Nut in remaining hole location.

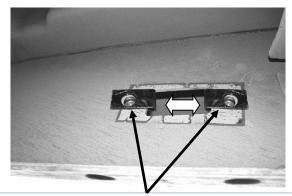

(Fig 2) Slide M8 Clip Nuts Over Holes

STEP 3

Starting installation from the driver side front of the vehicle. Select (1) Driver Front Mounting Bracket (**DFM/PRM**), attach the Mounting Bracket to the (2) M8 Clip Nuts with the included (2) M8x1.25-30mm Hex Bolts, (2) M8 Lock Washers and (2) M8 Large Flat Washers, (**Figs 3 & 4**). Depending on model and year, the brake cable may be run on the inside or outside of the Bracket. Do not fully tighten hardware at this time.


NOTE: The cradle on the front Bracket should face to the rear of the vehicle.

iBoard®

(2) M8x1.25-30mm Hex Bolts (2) M8 Lock Washers (2) M8 Large Flat Washers (2) M8 Large Flat Washers (2) M8 Large Flat Washers (2) M8 Lock Washers (2) M8 Large Flat Washers (2) M8 Lock Washers (2) M8 Large Flat Washers (3) M8 Large Flat Washers (3) M8 Large Flat Washers (4) M8 Large Flat Washers (5) M8 Large Flat

STEP 4

Align the bottom holes in the Driver Front Mounting Bracket with the (2) holes in the pinch weld. Bolt the Bracket to the pinch weld using the included (2) M8x1.25-25mm Hex Bolts, (4) M8 Flat Washers, (2) M8 Lock Washers and (2) M8 Hex Nuts, (Fig 4). NOTE: Insert the bolts up from the bottom of the pinch weld and through the Bracket. Do not fully tighten hardware at this time.

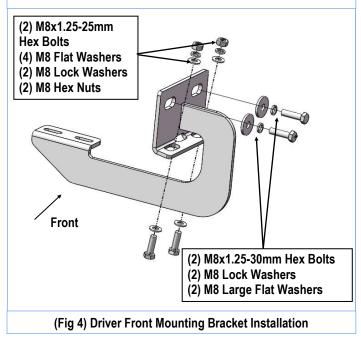

STEP 5

Continue along the cab to the rear mounting location. Locate the last (2) mounting holes in the pinch weld towards the back of the cab, (Fig 1). Repeat Steps 2—4 for Driver Rear Mounting Bracket (PFM/DRM) installation. NOTE: The cradle on the rear Bracket should face the front of the vehicle. Do not fully tighten hardware at this time.

STEP 6

Select a Running Board. Slip (2) M6x1-20mm Square Head Bolts into each bottom channel (**Fig 5**). Carefully position the Running Board onto the (2) Mounting Brackets.


IMPORTANT: Do not slide the Running Board on the Brackets or the bottom surface of the board will be damaged. Attach the Running Board to each Mounting Bracket with (2) M6x1-20mm Square Head Bolts, (2) M6 Large Flat Washers and (2) M6 X1 Nylon Lock Nuts (**Fig 6**). Do not fully tighten hardware at this time.



(Fig 5) Slip M6X1-20mm Square Head Bolts Into The Bottom Channels

Board®

(2) M6X1-20mm Square Head Bolts(2) M6 Large Flat Washers(2) M6X1 Nylon Lock Nuts

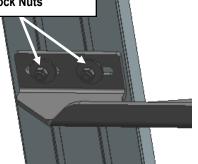

(Fig 6) Running Board Installed Onto Driver Center Mounting Bracket

STEP 7

Level and adjust the Running Board and fully tighten all hardware.

STEP 8

Repeat **Steps 1-7** for the other side Running Board installation. The installation is completed (**Fig 7**).



(Fig 7) Installation Completed

Attention Do periodic inspections to the installation to make sure that all hardware is secure and tight.

In order to protect your bars/boards, please use only mild soap/non-abrasive products for cleaning.